


The Trail Inventory of Aransas Austwell, TX

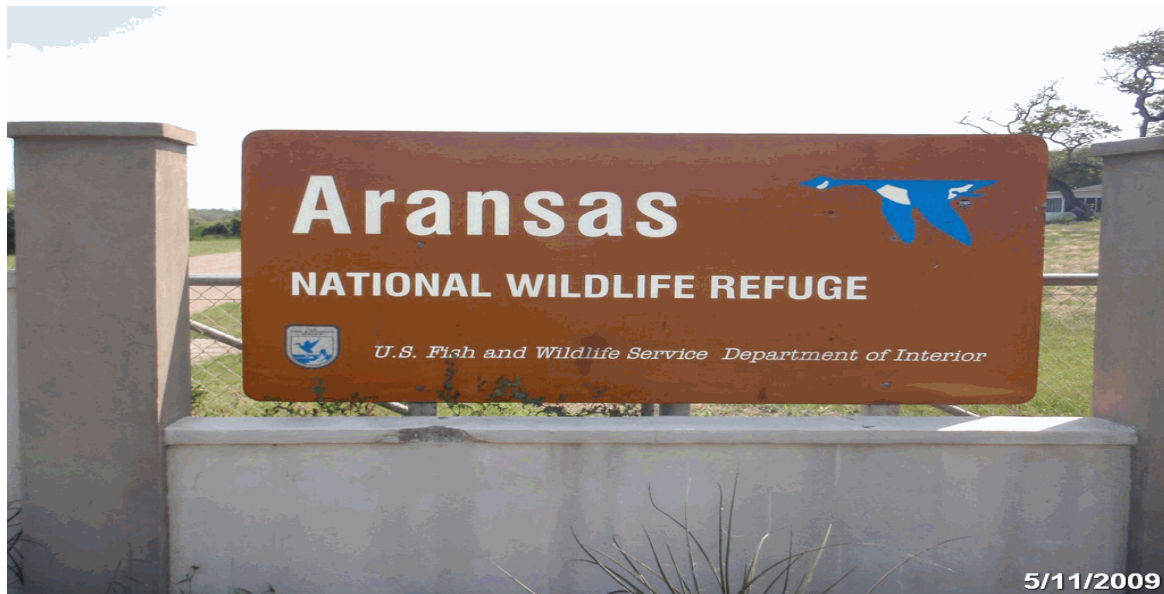

Prepared By:
Federal Highway Administration
Central Federal Lands Highway Division
February, 2012



TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
I. <u>TRAIL AND TRAIL FEATURE SUMMARIES</u>	1 - 1
II. <u>TRAIL LOCATION MAPS</u>	2 - 1
III. <u>TRAIL IDENTIFICATION LIST</u>	3 - 1
IV. <u>TRAIL CONDITION RATING SHEETS</u>	4 - 1
V. <u>TRAIL DEFICIENCY RATING SHEETS</u>	5 - 1
VI. <u>PHOTOGRAPHIC SHEETS</u>	6 - 1
VII. <u>GLOSSARY</u>	i

Aransas

Trail and Trail Feature Summaries

Trail Miles and Percentages by Surface Type and Condition

Trail Surface Type	Excellent		Good		Total
	Miles	%	Miles	%	Miles
Native	1.82	96%	0.07	4%	1.89
Gravel	0.64	100%	0.00	0%	0.64
Asphalt	0.07	100%	0.00	0%	0.07
Concrete	0.07	100%	0.00	0%	0.07
Boardwalk	0.35	100%	0.00	0%	0.35
Mowed	1.61	100%	0.00	0%	1.61
Total	4.56	98%	0.07	2%	4.63

Trail Miles and Percentages by Trail Classification and Condition

Trail Classification	Excellent		Good		Total
	Miles	%	Miles	%	Miles
TC1	0.16	100%	0.00	0%	0.16
TC2	1.07	100%	0.00	0%	1.07
TC3	2.20	97%	0.07	3%	2.27
TC4	0.99	100%	0.00	0%	0.99
TC5	0.14	100%	0.00	0%	0.14
Total	4.56	98%	0.07	2%	4.63

*Admin Roads are included in the inventory but are not rated for condition.

Trail Features

Trail Number	Feature Type	Quantity	Grouped Feature	Milepost	Photo
T201	Bench	1	No	0.00	
T201	Other	1	No	0.00	
T201	Trailhead	1	No	0.00	ARAN_C2_017 4
T201	Sign	1	No	0.11	ARAN_C2_017 5
T201	Step: Log -each	8	No	0.24	
T201	Max Grade- %	14	No	0.24	
T201	Bench	1	No	0.36	
T201	Bench	1	No	0.54	
T300	Sign	1	No	0.00	ARAN_C2_014 1
T300	Trailhead	1	No	0.00	ARAN_C2_014 1
T300	Begin Section	1	No	0.02	
T300	Max Grade- %	4	No	0.07	
T300	Intersection	1	No	0.35	
T300	Boardwalk -lf	80	No	0.36	ARAN_C2_014 5
T300	Sign	1	No	0.38	ARAN_C2_014 6
T301	Begin Section	1	No	0.00	
T301	Trailhead	1	No	0.00	ARAN_C2_015 1
T301	Sign	1	No	0.00	ARAN_C2_015 1
T301	Max Grade- %	8	No	0.01	
T301	Culvert -lf	122	No	0.01	
T301	Sign	25	Yes	0.01	ARAN_C2_014 8
T301	Begin Section	1	No	0.04	ARAN_C2_015 4
T301	Begin Section	1	No	0.04	ARAN_C2_015 3
T301	Bench	1	No	0.05	
T301	Lookout/Ob Deck	1	No	0.06	
T301	Max Grade- %	10	No	0.06	
T301	Sign	0	Yes	0.07	
T301	Sign	0	Yes	0.08	
T301	Begin Section	1	No	0.10	ARAN_C2_014 9
T301	Sign	0	Yes	0.14	

T301	Sign	0	Yes	0.18	
T301	Sign	0	Yes	0.20	
T301	Sign	1	No	0.22	ARAN_C2_015 0
T301	Sign	0	Yes	0.24	
T301	Sign	0	Yes	0.25	
T301	Sign	0	Yes	0.39	
T301	Sign	0	Yes	0.43	
T301	Sign	0	Yes	0.43	
T301	Sign	0	Yes	0.45	
T301	Sign	0	Yes	0.48	
T301	Begin Section	1	No	0.65	ARAN_C2_016 0
T301	Sign	0	Yes	0.65	
T301	Sign	0	Yes	0.66	
T301	Bench	1	No	0.69	
T301	Sign	0	Yes	0.69	
T301	Sign	0	Yes	0.69	
T301	Sign	0	Yes	0.76	
T301	Lookout/Ob Deck	1	No	0.76	
T301	Sign	0	Yes	0.80	
T301	Sign	0	Yes	0.83	
T301	Bench	1	No	0.84	
T301	Begin Section	1	No	0.85	ARAN_C2_016 2
T301	Boardwalk -lf	160	No	0.87	ARAN_C2_016 2
T301	Begin Section	1	No	0.90	ARAN_C2_016 4
T301	Sign	1	No	0.90	ARAN_C2_016 3
T301	Sign	0	Yes	0.91	
T301	Sign	0	Yes	0.95	
T301	Sign	0	Yes	0.98	
T301	Sign	0	Yes	1.02	
T301	Sign	0	Yes	1.10	
T302	Sign	2	No	0.00	ARAN_C2_016 9
T302	Trailhead	1	No	0.00	ARAN_C2_016 9
T302	Max Grade- %	8	No	0.01	
T302	Sign	0	No	0.05	
T302	Bench	1	No	0.05	
T302	Sign	2	Yes	0.10	ARAN_C2_017 0
T304	Trailhead	1	No	0.00	ARAN_C2_017 7

T304	Sign	2	No	0.00	ARAN_C2_017 8
T304	Culvert -lf	11	No	0.05	
T304	Begin Section	1	No	0.12	ARAN_C2_018 2
T304	Sign	1	No	0.16	ARAN_C2_018 1
T304	Max Grade- %	5	No	0.17	
T304	Bench	1	No	0.23	
T304	Sign	1	No	0.24	ARAN_C2_018 3
T304	Begin Section	1	No	0.24	ARAN_C2_018 7
T304	Other	1	No	0.26	
T304	Max Grade- %	8	No	0.29	
T304	Bench	1	No	0.35	
T305	Trailhead	1	No	0.00	ARAN_C2_020 9
T305	Sign	3	No	0.05	ARAN_C2_021 0
T305	Bench	1	No	0.05	
T305	Other	1	No	0.05	
T305	Max Grade- %	11	No	0.06	
T305	Begin Section	1	No	0.06	ARAN_C2_021 6
T305	Sign	1	No	0.07	ARAN_C2_021 3
T306	Trailhead	1	No	0.00	ARAN_C2_022 0
T306	Max Grade- %	5	No	0.01	
T306	Sign	2	No	0.01	ARAN_C2_021 9
T306	Sign	1	No	0.23	ARAN_C2_021 7
T306	Max Grade- %	6	No	0.26	
T306	Lookout/Ob Deck	1	No	0.32	
T400	Trailhead	1	No	0.00	ARAN_C2_013 9
T400	Begin Section	1	No	0.02	ARAN_C2_014 0
T400	Max Grade- %	9	No	0.02	
T402	Sign	2	No	0.00	ARAN_C2_018 9
T402	Culvert -lf	18	No	0.00	
T402	Trailhead	1	No	0.00	ARAN_C2_019 2
T402	Sign	2	No	0.01	ARAN_C2_019 1
T402	Bench	1	No	0.23	




T402	Sign	1	No	0.23	ARAN_C2_019 3
T402	Max Grade- %	5	No	0.29	
T402	Sign	1	No	0.37	ARAN_C2_019 6
T402	Bench	1	No	0.41	
T402	Begin Section	1	No	0.41	ARAN_C2_019 8
T402	Sign	1	No	0.46	ARAN_C2_020 1
T402	Begin Section	1	No	0.46	ARAN_C2_020 6
T402	Lookout/Ob Deck	1	No	0.49	
T402	Lookout/Ob Deck	1	No	0.52	
T402	Sign	2	Yes	0.52	ARAN_C2_020 3
T402	Sign	0	No	0.55	
T402	Lookout/Ob Deck	1	No	0.58	
T402	Sign	2	No	0.60	ARAN_C2_020 4
T402	Bench	1	No	0.60	
T500	Trailhead	1	No	0.00	ARAN_C2_016 5
T500	Begin Section	1	No	0.02	ARAN_C2_016 6
T500	Max Grade- %	6	No	0.02	
T500	Boardwalk -lf	124	No	0.04	ARAN_C2_016 7
T500	Bench	2	No	0.04	
T502	Trailhead	1	No	0.00	ARAN_C2_022 1
T502	Max Grade- %	2	No	0.02	
T502	Sign	1	No	0.02	ARAN_C2_022 2
T502	Lookout/Ob Deck	1	No	0.03	
T503	Sign	1	No	0.00	ARAN_C2_022 4
T503	Trailhead	1	No	0.00	ARAN_C2_022 5
T503	Max Grade- %	3	No	0.02	
T503	Sign	1	No	0.03	ARAN_C2_022 7
T503	Lookout/Ob Deck	1	No	0.03	

sf - square feet

lf - linear feet

cf - cubic feet

Aransas Trail Location Map

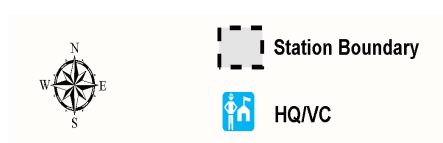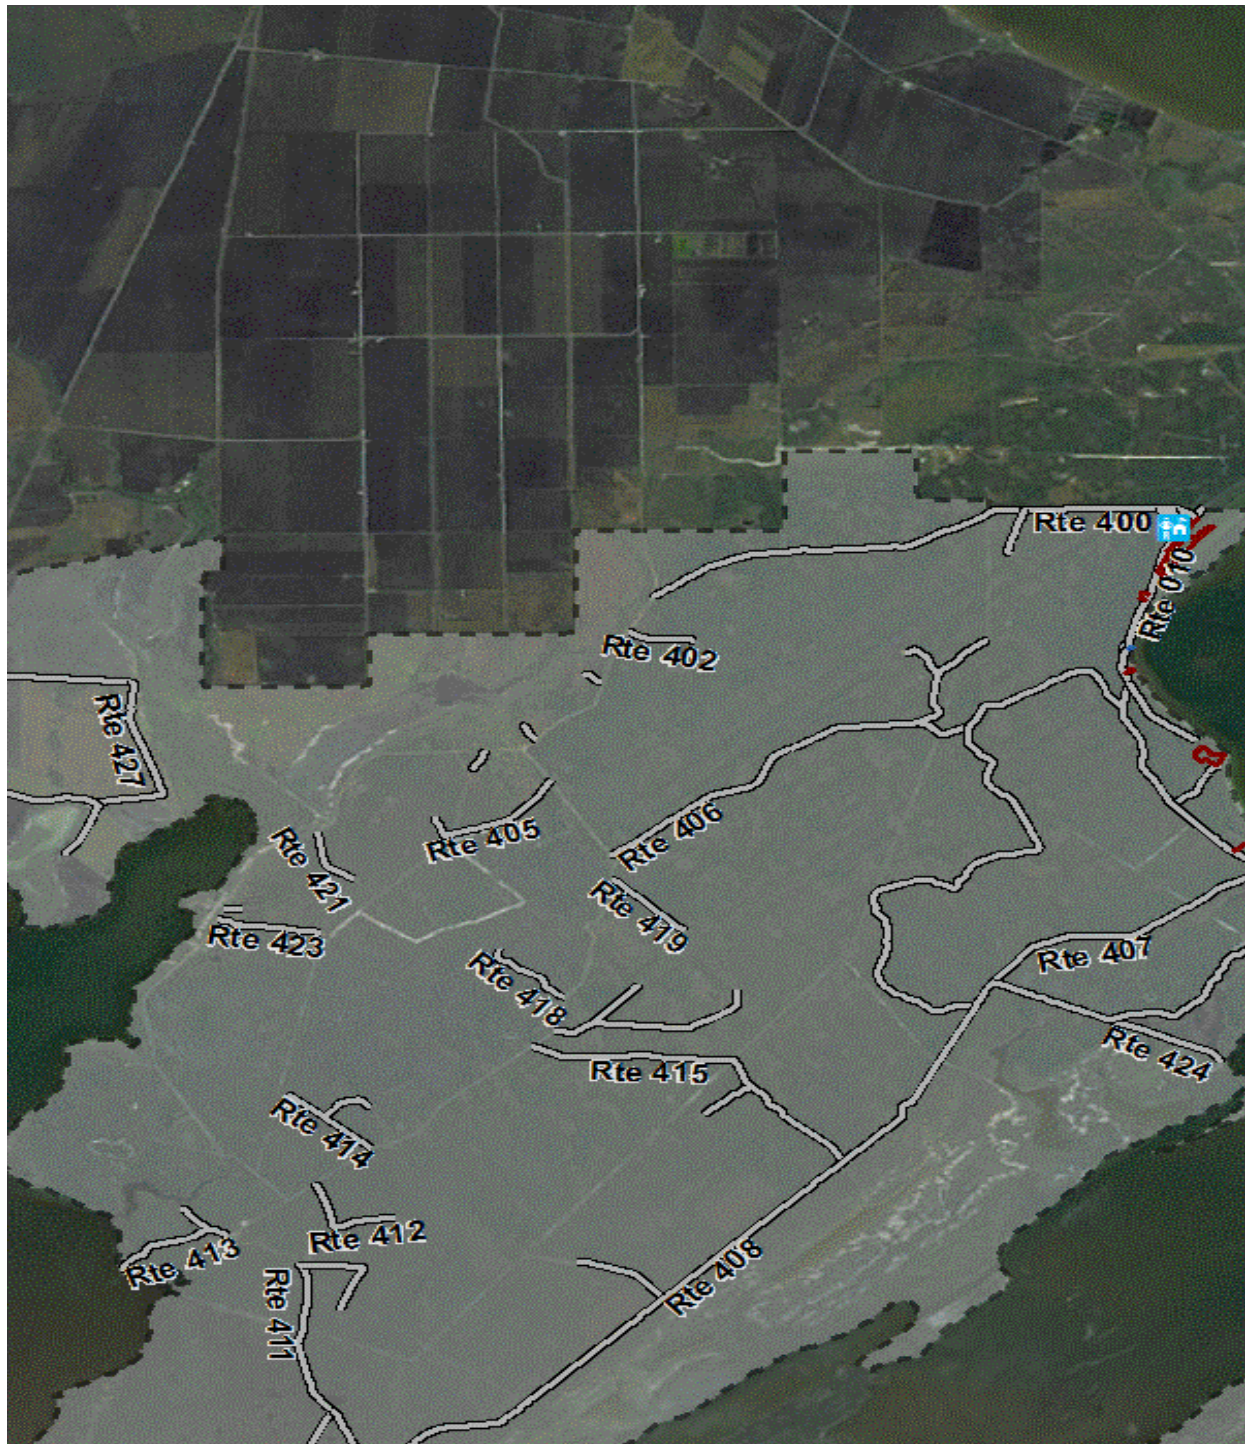

Trails ID


Station Name: Aransas

Org Code: 21532

Trail Number	Trail Name	Surface Type	SAMMS	Trail Mileage	Trail Description (Begin and End point of trail)
T201	Dagger Point Trail	Native	N/A	0.66	From Dagger Point Parking Area (Rte 905) To End of trail
T300	Rail Trail	Mowed	N/A	0.43	From Visitor Center Parking Area (Rte 900) To End of section
T301	Heron Flats Trail	Asphalt	N/A	0.04	From Heron Flats Parking Area (Rte 902) To End of trail
T301	Heron Flats Trail	Boardwalk	N/A	0.08	From Heron Flats Parking Area (Rte 902) To End of trail
T301	Heron Flats Trail	Mowed	N/A	0.74	From Heron Flats Parking Area (Rte 902) To End of trail
T301	Heron Flats Trail	Native	N/A	0.53	From Heron Flats Parking Area (Rte 902) To End of trail
T302	Birding Trail #1	Native	N/A	0.15	From FM 2040 To End of trail
T304	Birding Trail # 2	Mowed	N/A	0.12	From FM 2040 To End of section
T304	Birding Trail # 2	Native	N/A	0.29	From FM 2040 To End of section
T305	Bay Overlook Trail	Native	N/A	0.10	From Bay Overlook Parking Area (Rte 904) To Section 001
T306	Tatton Trail	Mowed	N/A	0.32	From Hwy 35N To End of trail
T400	Frog Pond Trail	Concrete	N/A	0.02	From Visitor Center Parking Area (Rte 900) To Visitor Center Parking Area (Rte 900)
T400	Frog Pond Trail	Native	N/A	0.16	From Visitor Center Parking Area (Rte 900) To Visitor Center Parking Area (Rte 900)
T402	Big Tree Trail	Boardwalk	N/A	0.25	From Hog Lake Parking Area #1 (Rte 909) To Observation Tower Parking Area (Rte 907)
T402	Big Tree Trail	Gravel	N/A	0.64	From Hog Lake Parking Area #1 (Rte 909) To Observation Tower Parking Area (Rte 907)

T500	N/A	Boardwalk	N/A	0.02	From Bay Overlook Picnic Parking (Rte 912) To End of trail
T500	N/A	Concrete	N/A	0.02	From Bay Overlook Picnic Parking (Rte 912) To End of trail
T502	Hog Lake Trail	Asphalt	N/A	0.03	From Hog Lake Parking Area #2 (Rte 906) To End of trail
T503	Jones Lake Trail	Concrete	N/A	0.03	From Jones Lake Parking Area (Rte 908) To End of trail

TRAIL CONDITION

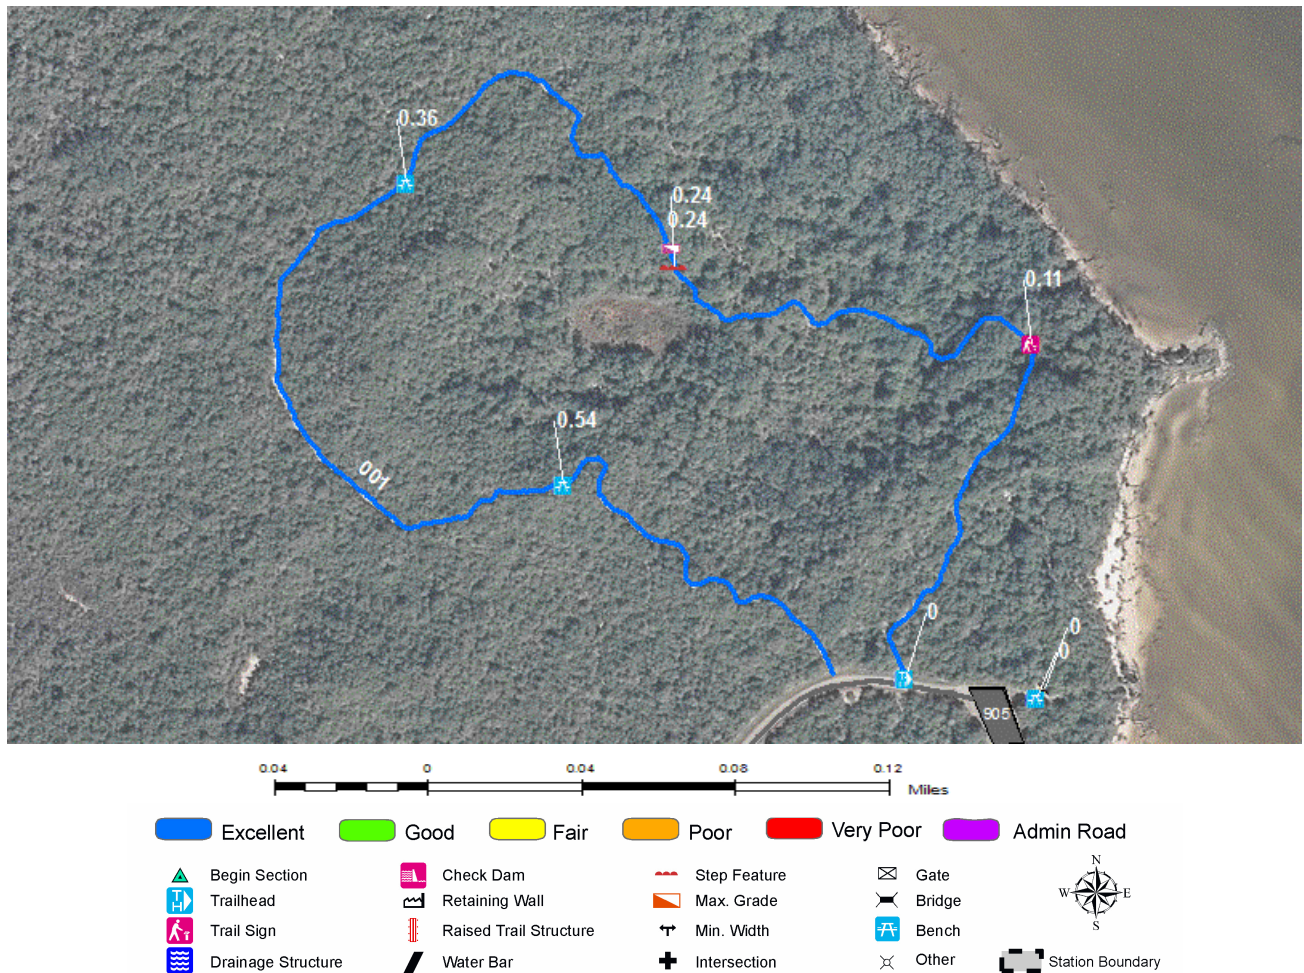

Trail Name: Dagger Point Trail
Trail Number: T201

Refuge Name: Aransas
Region: 2


Total Length: 0.66 Miles

Section Number	001
Section Length (miles)	0.66
SAMMS Number	N/A
Rating Date	03/16/2011
Trail Section Information	
Trail Class	TC2
Surface Type	Native
Surface Firmness	Paved
Width (inches)	48
Average Grade (%)	6.6
Average X-slope (%)	0.88
Trail Condition Information	
Deferred Maintenance	
CRV	\$42,503
FCI	0.00
Condition	Excellent

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
	\$42,503	0.00	Excellent

TRAIL CONDITION

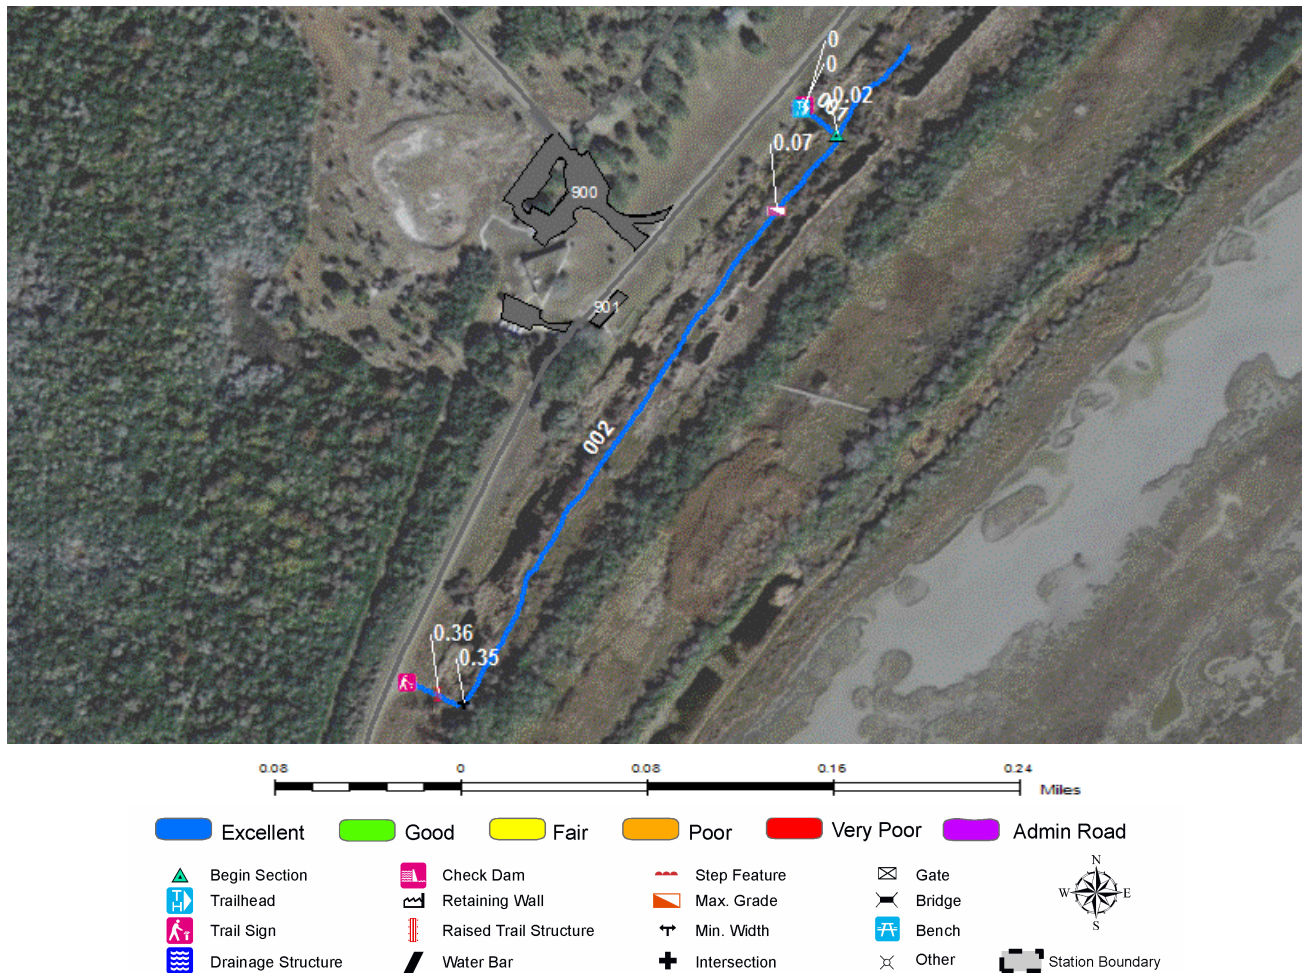

Trail Name: Rail Trail
Trail Number: T300

Refuge Name: Aransas
Region: 2

Total Length: 0.43 Miles

Section Number	001	002
Section Length (miles)	0.07	0.36
SAMMS Number	N/A	N/A
Rating Date	03/15/2011	03/15/2011
Trail Section Information		
Trail Class	TC3	TC3
Surface Type	Mowed	Mowed
Surface Firmness	Hard	Hard
Width (inches)	132	132
Average Grade (%)	2.1	2.1
Average X-slope (%)	1.00	1.00
Trail Condition Information		
Deferred Maintenance		
CRV	\$3,100	\$15,939
FCI	0.00	0.00
Condition	Excellent	Excellent

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
	\$19,038	0.00	Excellent

TRAIL CONDITION




Trail Name: Heron Flats Trail
Trail Number: T301

Refuge Name: Aransas
Region: 2

Total Length: 1.39 Miles

Section Number	001	002	003	004	005
Section Length (miles)	0.04	0.03	0.61	0.20	0.05
SAMMS Number	N/A	N/A	N/A	N/A	N/A
Rating Date	03/15/2011	03/15/2011	03/15/2011	03/15/2011	03/15/2011
Trail Section Information					
Trail Class	TC5	TC5	TC3	TC3	TC4
Surface Type	Asphalt	Boardwalk	Mowed	Native	Boardwalk
Surface Firmness	Firm	Boardwalk	Hard	Hard	Boardwalk
Width (inches)	85	85	85	85	85
Average Grade (%)	2.6	2.6	2.6	2.6	2.6
Average X-slope (%)	1.16	1.16	1.16	1.16	1.16
Trail Condition Information					
Deferred Maintenance					
CRV	\$6,382	\$18,497	\$17,391	\$22,808	\$30,828
FCI	0.00	0.00	0.00	0.00	0.00
Condition	Excellent	Excellent	Excellent	Excellent	Excellent

TRAIL CONDITION

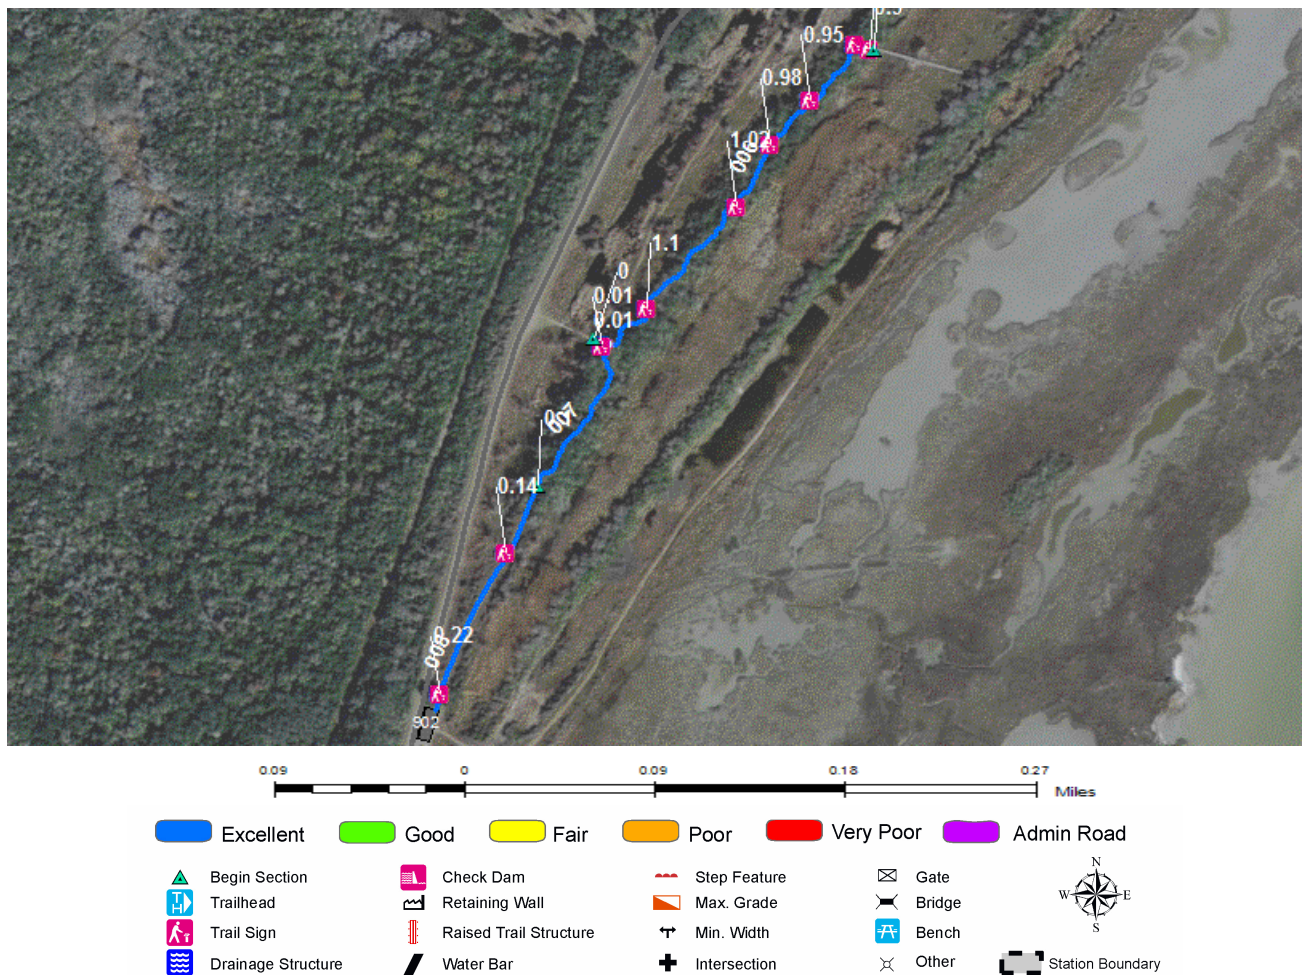

Trail Name: Heron Flats Trail
Trail Number: T301

Refuge Name: Aransas
Region: 2



Total Length: 1.39 Miles

Section Number	006	007	008
Section Length (miles)	0.23	0.10	0.13
SAMMS Number	N/A	N/A	N/A
Rating Date	03/15/2011	03/15/2011	03/15/2011
Trail Section Information			
Trail Class	TC3	TC3	TC3
Surface Type	Native	Native	Mowed
Surface Firmness	Hard	Hard	Hard
Width (inches)	85	85	85
Average Grade (%)	2.6	2.6	2.6
Average X-slope (%)	1.16	1.16	1.16
Trail Condition Information			
Deferred Maintenance			
CRV	\$26,229	\$11,404	\$3,706
FCI	0.00	0.00	0.00
Condition	Excellent	Excellent	Excellent

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
	\$137,246	0.00	Excellent

TRAIL CONDITION

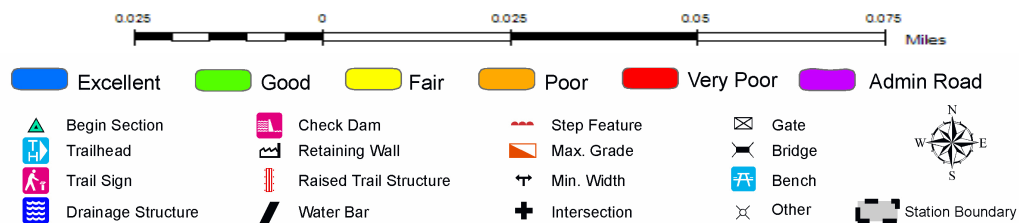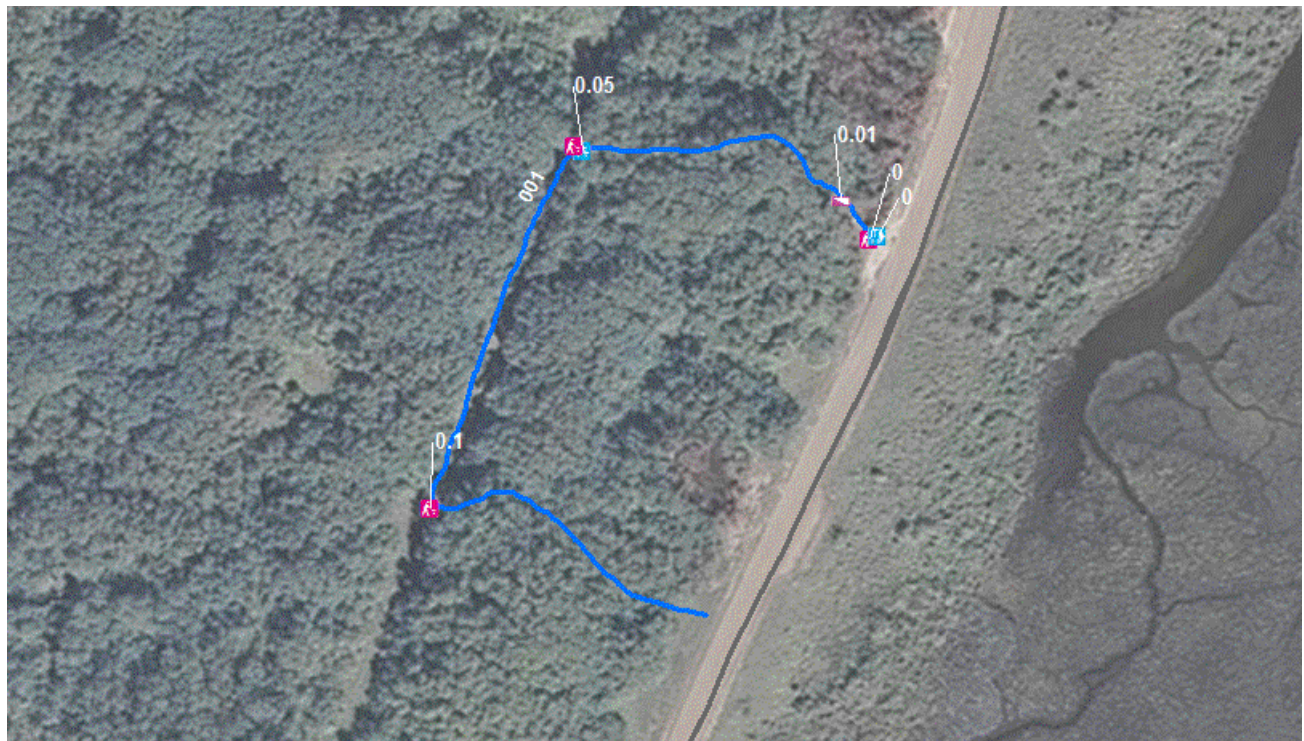

Trail Name: Birding Trail #1
Trail Number: T302

Refuge Name: Aransas
Region: 2



Total Length: 0.15 Miles

Section Number	001
Section Length (miles)	0.15
SAMMS Number	N/A
Rating Date	03/15/2011
Trail Section Information	
Trail Class	TC3
Surface Type	Native
Surface Firmness	Hard
Width (inches)	55
Average Grade (%)	2.5
Average X-slope (%)	1.58
Trail Condition Information	
Deferred Maintenance	
CRV	\$11,069
FCI	0.00
Condition	Excellent

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
	\$11,069	0.00	Excellent

TRAIL CONDITION

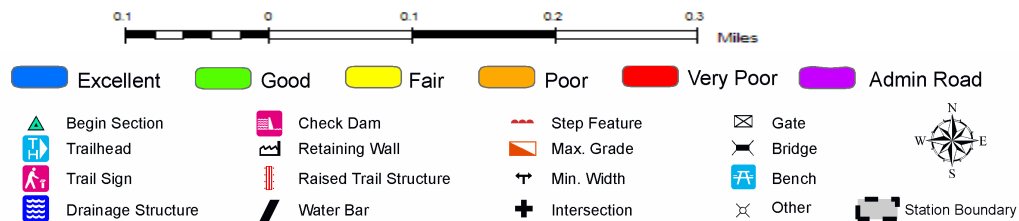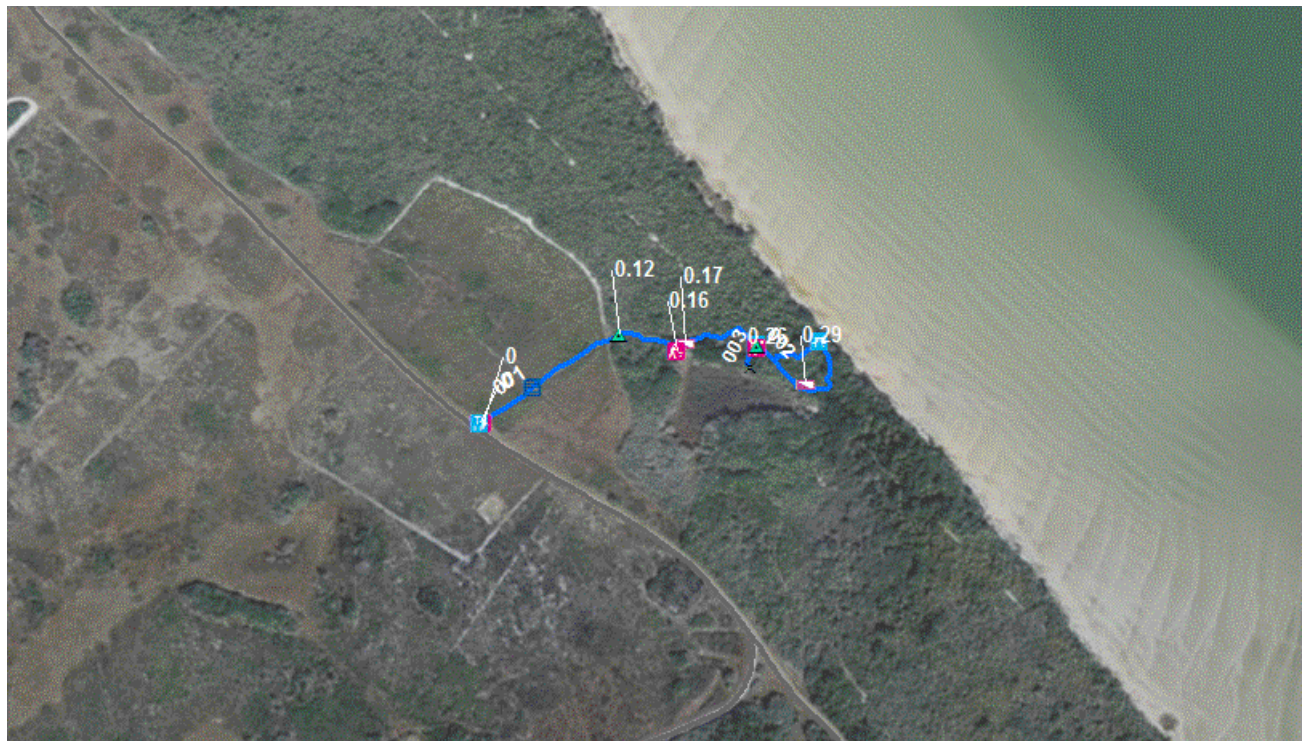

Trail Name: Birding Trail # 2
Trail Number: T304

Refuge Name: Aransas
Region: 2


Total Length: 0.41 Miles

Section Number	001	002	003
Section Length (miles)	0.12	0.27	0.02
SAMMS Number	N/A	N/A	N/A
Rating Date	03/16/2011	03/16/2011	03/16/2011
Trail Section Information			
Trail Class	TC2	TC2	TC2
Surface Type	Mowed	Native	Native
Surface Firmness	Hard	Hard	Paved
Width (inches)	120	120	120
Average Grade (%)	3.4	3.4	3.4
Average X-slope (%)	2.20	2.20	2.20
Trail Condition Information			
Deferred Maintenance		\$451	
CRV	\$4,830	\$43,469	\$3,220
FCI	0.00	0.01	0.00
Condition	Excellent	Excellent	Excellent

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
\$451	\$51,519	0.01	Excellent

TRAIL CONDITION

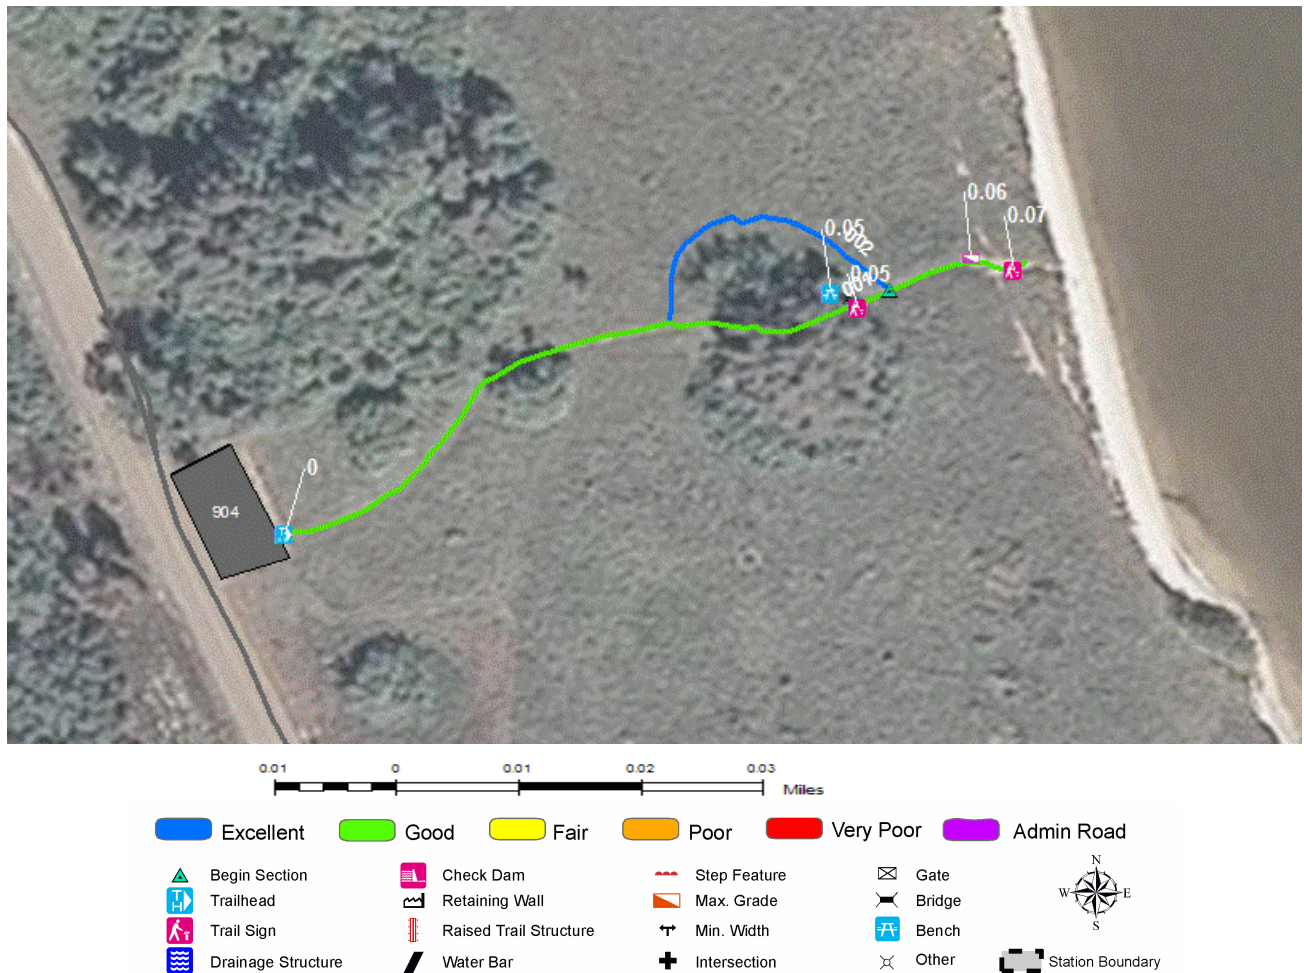

Trail Name: Bay Overlook Trail
Trail Number: T305

Refuge Name: Aransas
Region: 2


Total Length: 0.10 Miles

Section Number	001	002
Section Length (miles)	0.07	0.03
SAMMS Number	N/A	N/A
Rating Date	03/16/2011	03/16/2011
Trail Section Information		
Trail Class	TC3	TC3
Surface Type	Native	Native
Surface Firmness	Hard	Hard
Width (inches)	108	108
Average Grade (%)	3.4	3.4
Average X-slope (%)	1.68	1.68
Trail Condition Information		
Deferred Maintenance	\$381	
CRV	\$10,142	\$4,348
FCI	0.04	0.00
Condition	Good	Excellent

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
\$381	\$14,490	0.03	Good

TRAIL CONDITION

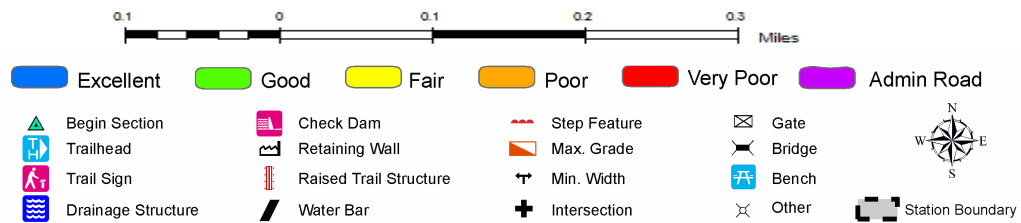

Trail Name: Tatton Trail
Trail Number: T306

Refuge Name: Aransas
Region: 2


Total Length: 0.32 Miles

Section Number	001
Section Length (miles)	0.32
SAMMS Number	N/A
Rating Date	03/16/2011
Trail Section Information	
Trail Class	TC3
Surface Type	Mowed
Surface Firmness	Hard
Width (inches)	108
Average Grade (%)	3.7
Average X-slope (%)	2.16
Trail Condition Information	
Deferred Maintenance	
CRV	\$11,592
FCI	0.00
Condition	Excellent

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
	\$11,592	0.00	Excellent

TRAIL CONDITION

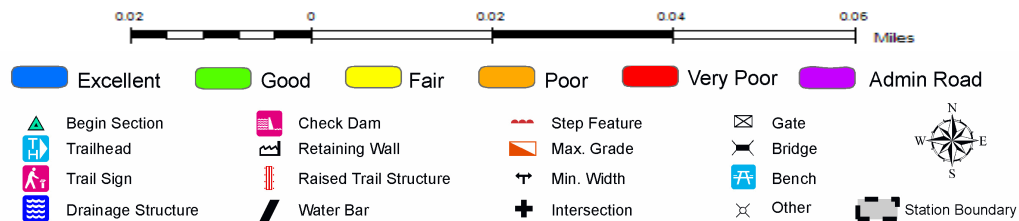

Trail Name: Frog Pond Trail

Refuge Name: Aransas

Trail Number: T400

Region: 2


Total Length: 0.18 Miles

Section Number	001	002
Section Length (miles)	0.02	0.16
SAMMS Number	N/A	N/A
Rating Date	03/15/2011	03/15/2011
Trail Section Information		
Trail Class	TC4	TC1
Surface Type	Concrete	Native
Surface Firmness	Hard	Paved
Width (inches)	66	66
Average Grade (%)	4.7	4.7
Average X-slope (%)	2.98	2.98
Trail Condition Information		
Deferred Maintenance		
CRV	\$2,774	\$14,167
FCI	0.00	0.00
Condition	Excellent	Excellent

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
	\$16,940	0.00	Excellent

TRAIL CONDITION

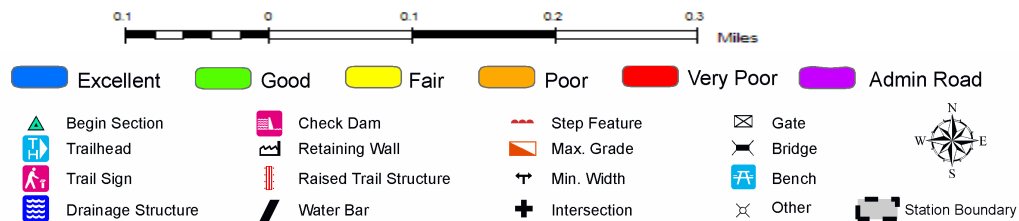

Trail Name: Big Tree Trail

Refuge Name: Aransas

Trail Number: T402

Region: 2



Total Length: 0.89 Miles

Section Number	001	002	003
Section Length (miles)	0.64	0.20	0.05
SAMMS Number	N/A	N/A	N/A
Rating Date	03/16/2011	03/16/2011	03/16/2011
Trail Section Information			
Trail Class	TC4	TC4	TC4
Surface Type	Gravel	Boardwalk	Boardwalk
Surface Firmness	Hard	Boardwalk	Boardwalk
Width (inches)	120	120	120
Average Grade (%)	2.7	2.7	2.7
Average X-slope (%)	1.72	1.72	1.72
Trail Condition Information			
Deferred Maintenance	\$31	\$31	
CRV	\$112,406	\$174,089	\$43,522
FCI	0.00	0.00	0.00
Condition	Excellent	Excellent	Excellent

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
\$62	\$330,017	0.00	Excellent

TRAIL CONDITION

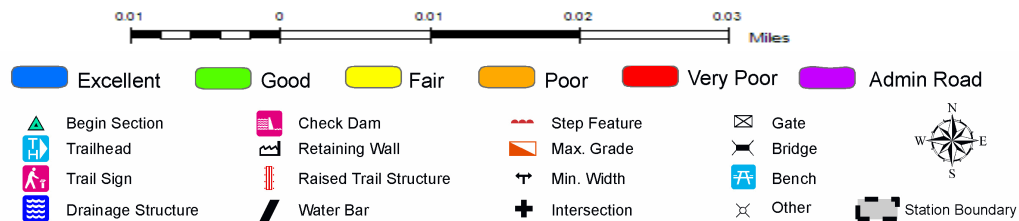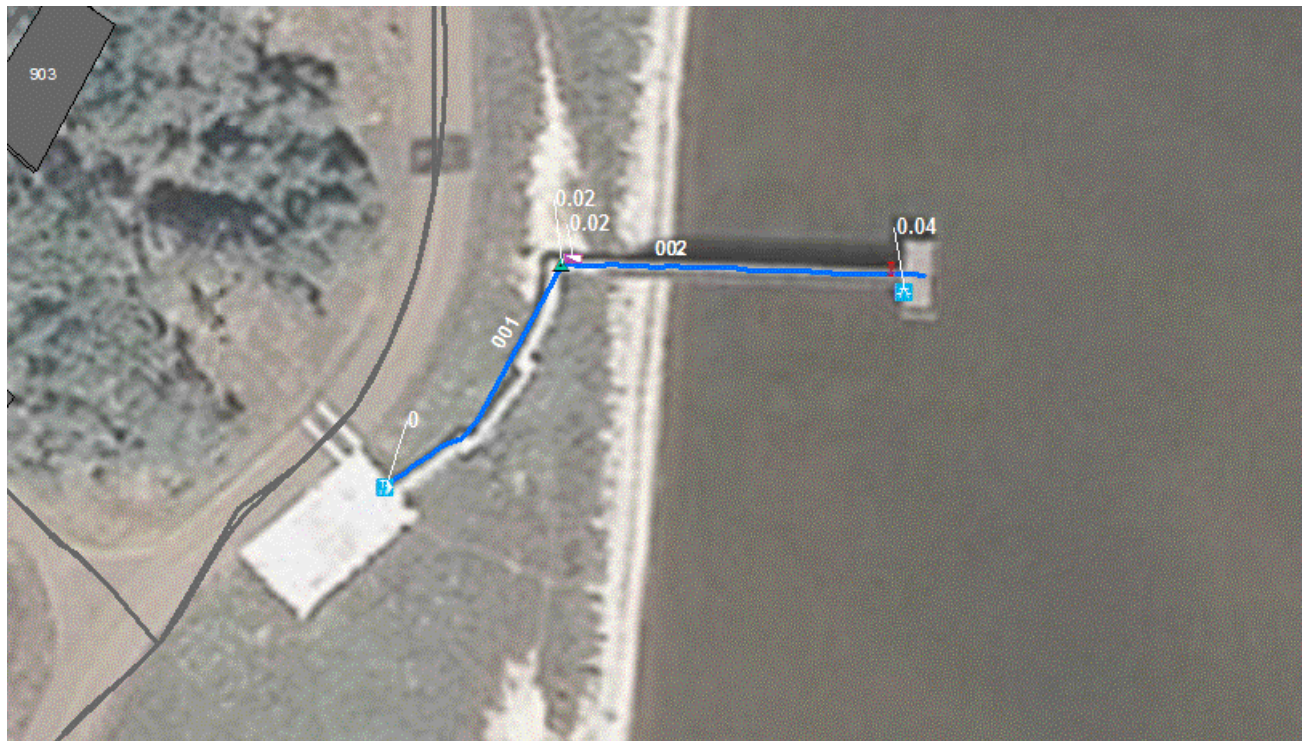

Trail Name: N/A

Refuge Name: Aransas

Trail Number: T500

Region: 2


Total Length: 0.04 Miles

Section Number	001	002
Section Length (miles)	0.02	0.02
SAMMS Number	N/A	N/A
Rating Date	03/15/2011	03/15/2011
Trail Section Information		
Trail Class	TC5	TC5
Surface Type	Concrete	Boardwalk
Surface Firmness	Firm	Boardwalk
Width (inches)	84	84
Average Grade (%)	4.1	4.1
Average X-slope (%)	0.42	0.42
Trail Condition Information		
Deferred Maintenance		
CRV	\$3,528	\$12,183
FCI	0.00	0.00
Condition	Excellent	Excellent

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
	\$15,711	0.00	Excellent

TRAIL CONDITION

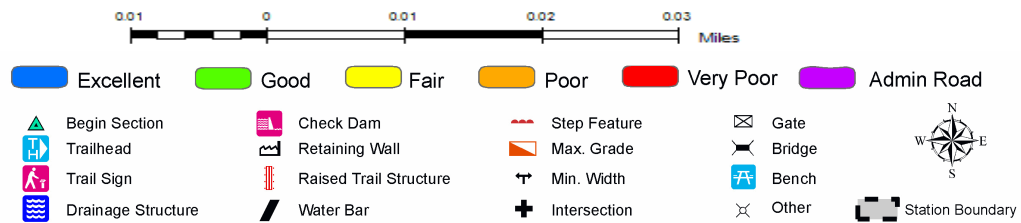

Trail Name: Hog Lake Trail
Trail Number: T502

Refuge Name: Aransas
Region: 2


Total Length: 0.03 Miles

Section Number	001
Section Length (miles)	0.03
SAMMS Number	N/A
Rating Date	03/16/2011
Trail Section Information	
Trail Class	TC4
Surface Type	Asphalt
Surface Firmness	Firm
Width (inches)	60
Average Grade (%)	1.4
Average X-slope (%)	0.78
Trail Condition Information	
Deferred Maintenance	
CRV	\$3,379
FCI	0.00
Condition	Excellent

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
	\$3,379	0.00	Excellent

TRAIL CONDITION

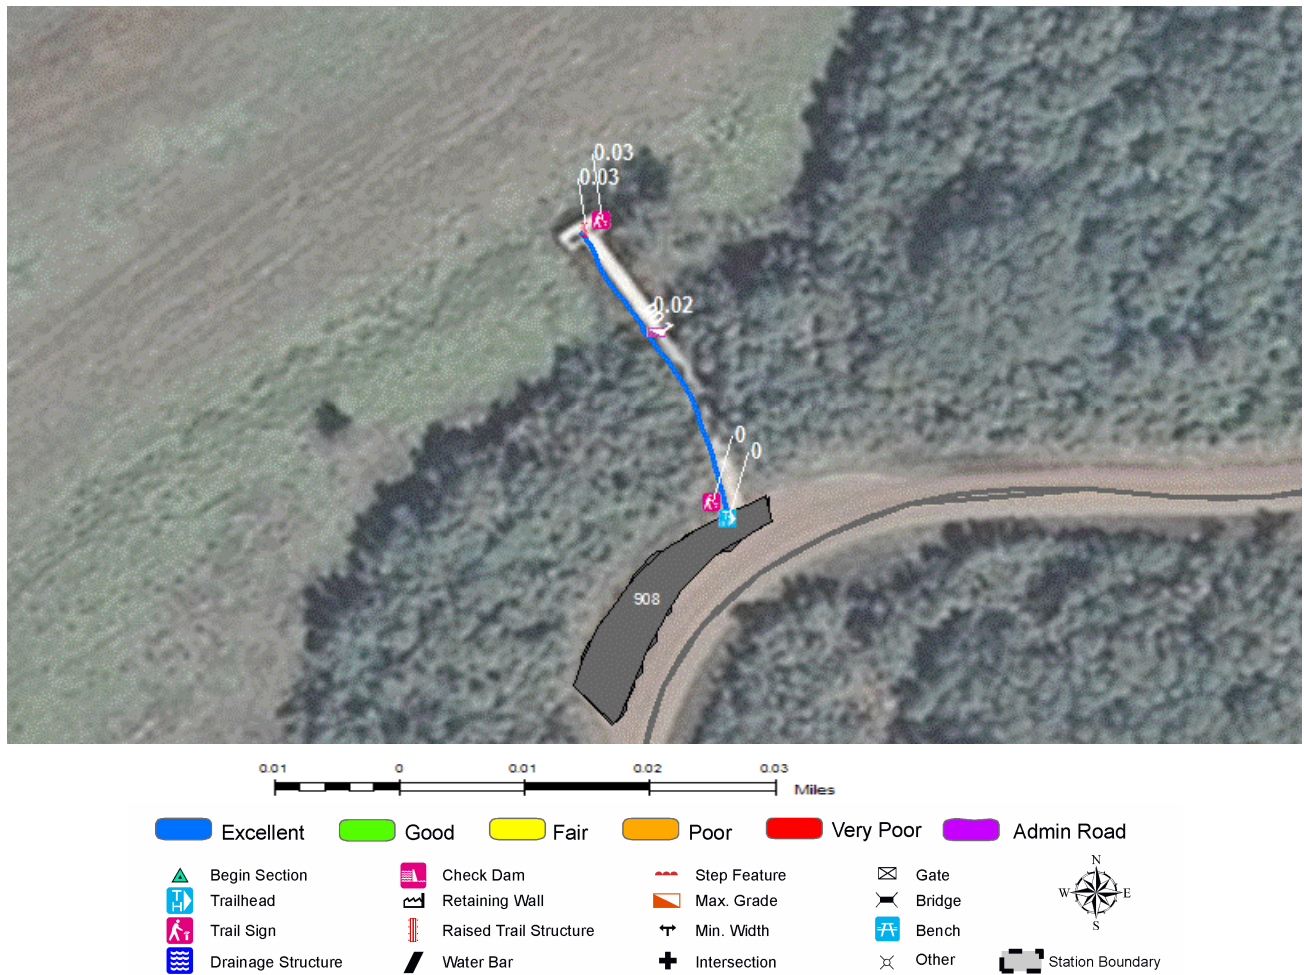

Trail Name: Jones Lake Trail
Trail Number: T503

Refuge Name: Aransas
Region: 2



Total Length: 0.03 Miles

Section Number	001
Section Length (miles)	0.03
SAMMS Number	N/A
Rating Date	03/16/2011
Trail Section Information	
Trail Class	TC5
Surface Type	Concrete
Surface Firmness	Firm
Width (inches)	48
Average Grade (%)	1.6
Average X-slope (%)	0.36
Trail Condition Information	
Deferred Maintenance	
CRV	\$3,027
FCI	0.00
Condition	Excellent

Trail Condition TOTALS

Deferred Maintenance	CRV	FCI	Condition
	\$3,027	0.00	Excellent

TRAIL DEFICIENCY

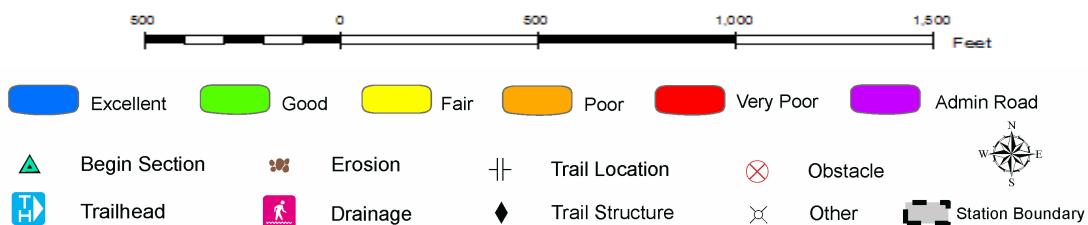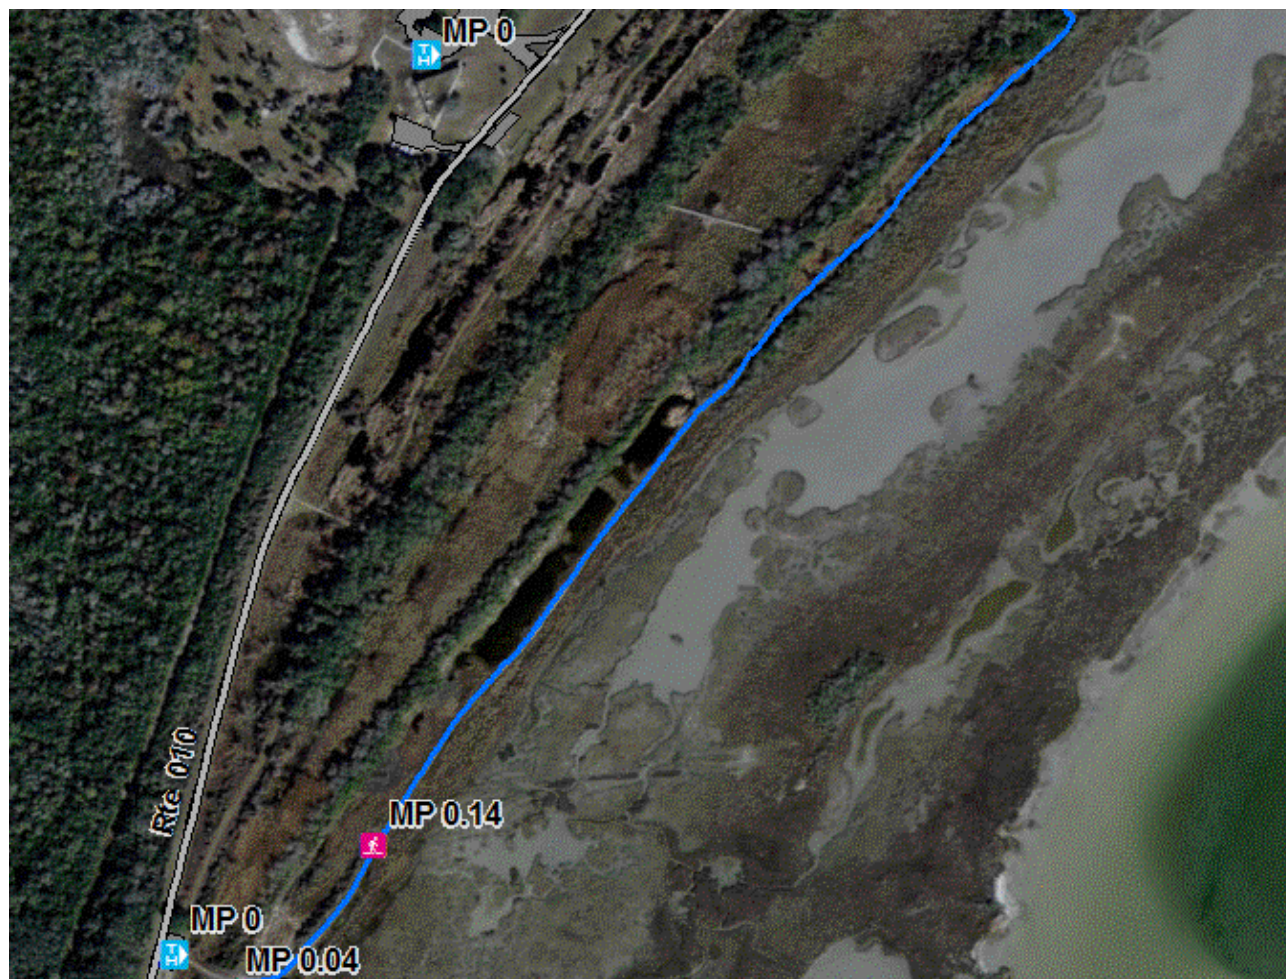

Trail Name: Heron Flats Trail

Refuge Name: Aransas



Trail Number: T301

Region: 2

Total Length: 1.39 Miles

Mile Post	0.14
Section Number	003
Photo Number	ARAN_C2_0155
Deficiency	Drainage
Action	Build/AddTread -sf
Item	Tread -sf
Quantity	16
Deferred Maintenance	

TRAIL DEFICIENCY

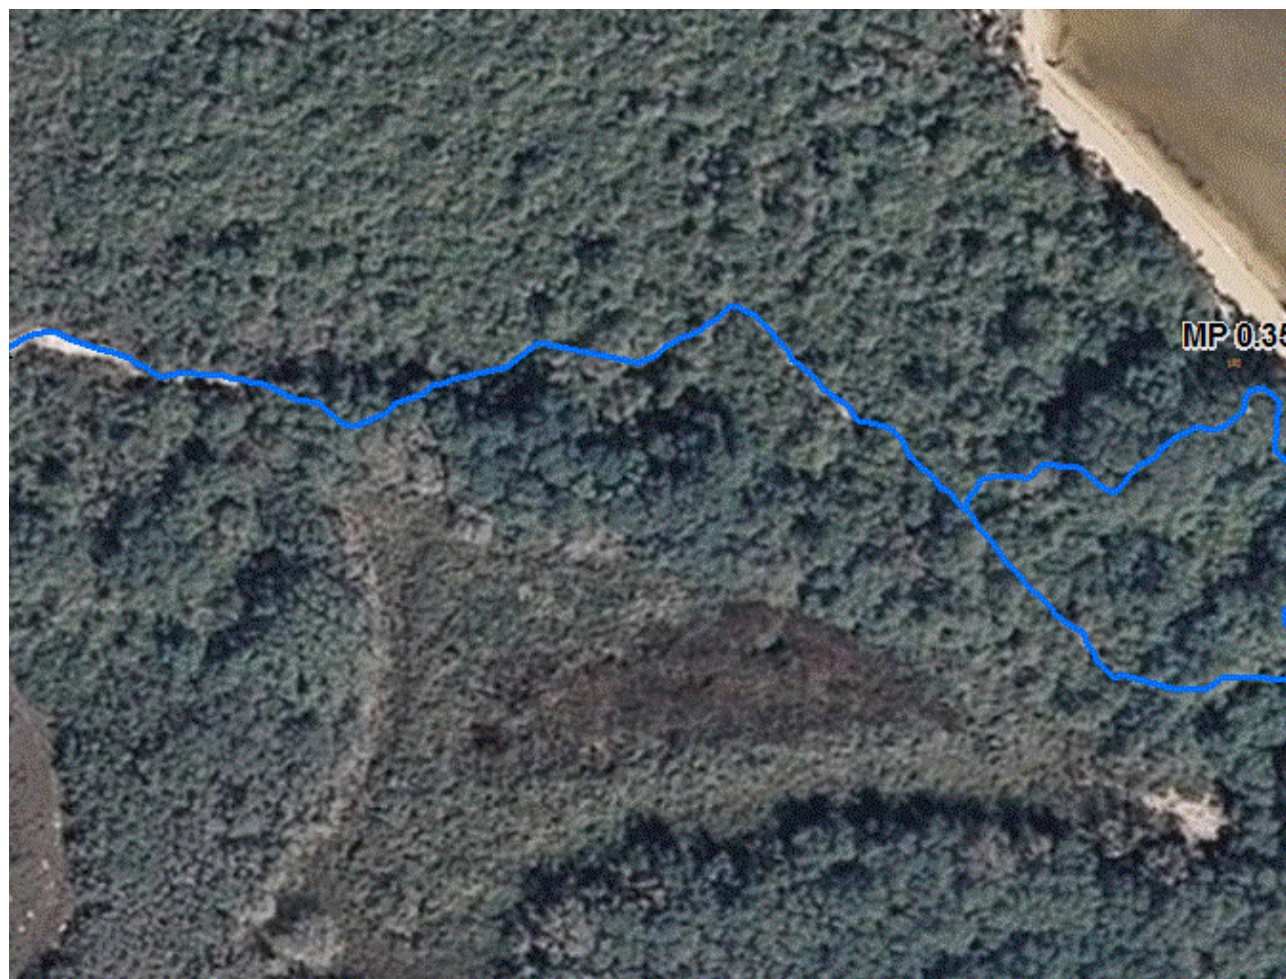

Trail Name: Birding Trail # 2

Trail Number: T304


Refuge Name: Aransas

Region: 2

Total Length: 0.41 Miles

Mile Post	0.35
Section Number	002
Photo Number	ARAN_C2_0186
Deficiency	Erosion
Action	Build/Add
Item	Step: Log -each
Quantity	6
Deferred Maintenance	\$451

TRAIL DEFICIENCY



Trail Name: Bay Overlook Trail

Refuge Name: Aransas



Trail Number: T305

Region: 2

Total Length: 0.10 Miles

Mile Post	0.07	0.07
Section Number	001	001
Photo Number	ARAN_C2_0214	ARAN_C2_0215
Deficiency	Erosion	Trail Location
Action	Build/Add	Remove
Item	Step: Log -each	Trail: Social -lf
Quantity	5	2
Deferred Maintenance	\$381	\$0

TRAIL DEFICIENCY

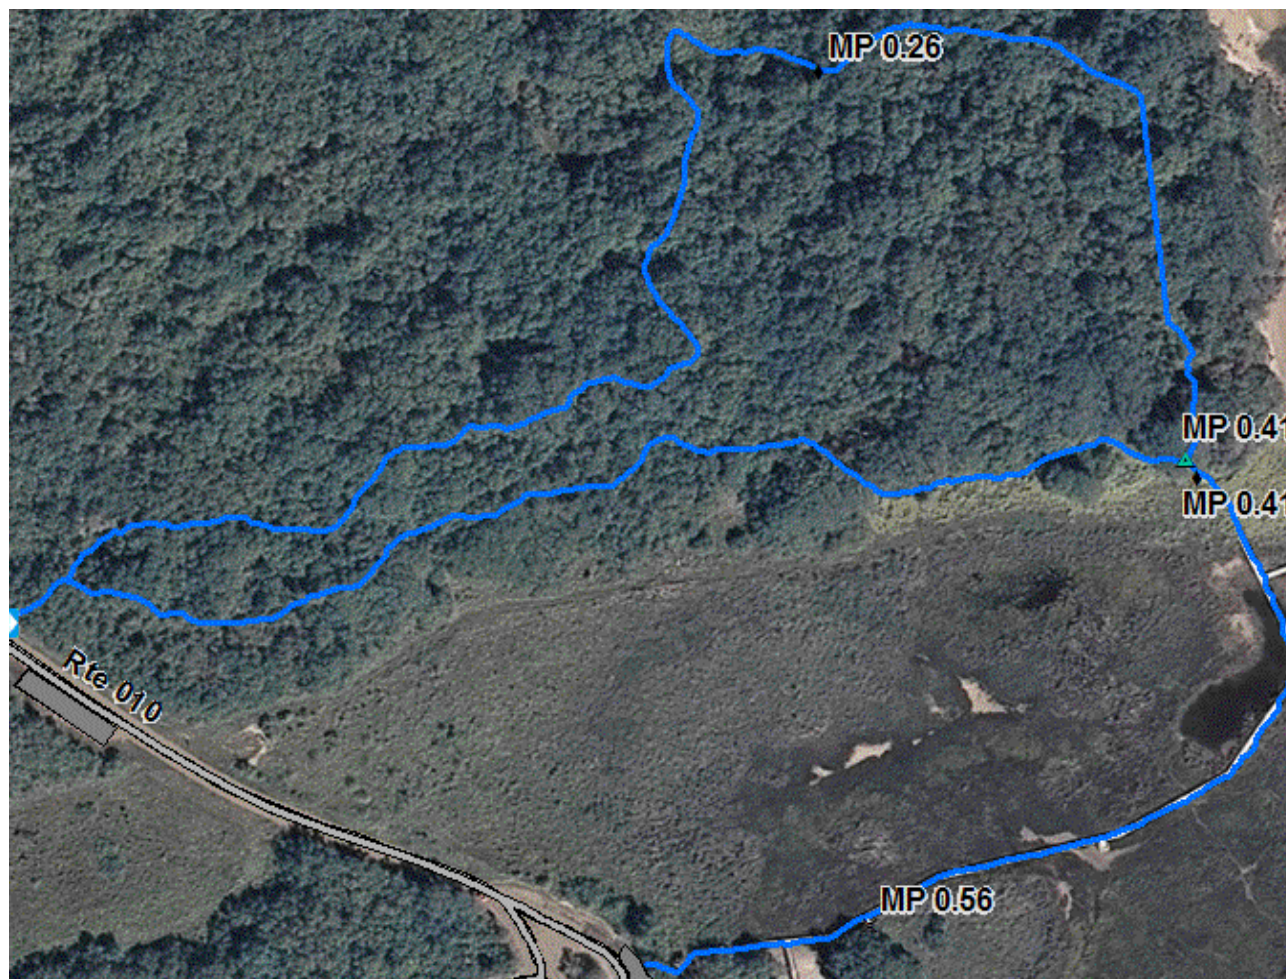

Trail Name: Big Tree Trail

Refuge Name: Aransas

Trail Number: T402

Region: 2

Total Length: 0.89 Miles

Mile Post	0.26	0.41	0.56
Section Number	001	002	002
Photo Number	ARAN_C2_0195	ARAN_C2_0199	ARAN_C2_0207
Deficiency	Trail Structure	Trail Structure	Other
Action	Repair	Repair	Remove
Item	Other	Other	Trail: Social -If
Quantity	1	2	125
Deferred Maintenance	\$31	\$31	\$0

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T201

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0174 - MP 0.00 - Trailhead

TRAIL NUMBER: T201

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0175 - MP 0.11 - Sign

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T300

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0141 - MP 0.00 - Trailhead

TRAIL NUMBER: T300

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0141 - MP 0.00 - Sign

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T300

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0145 - MP 0.36 - Boardwalk -lf

TRAIL NUMBER: T300

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0146 - MP 0.38 - Sign

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T301

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0151 - MP 0.00 - Trailhead

TRAIL NUMBER: T301

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0151 - MP 0.00 - Sign

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T301

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0153 - MP 0.04 - Begin Section

TRAIL NUMBER: T301

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0154 - MP 0.04 - Begin Section

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T301

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0160 - MP 0.65 - Begin Section

TRAIL NUMBER: T301

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0162 - MP 0.85 - Begin Section

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T301

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0162 - MP 0.87 - Boardwalk -lf

TRAIL NUMBER: T301

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0163 - MP 0.90 - Sign

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T301

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0164 - MP 0.90 - Begin Section

TRAIL NUMBER: T301

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0148 - MP 0.01 - Sign

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T301

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0149 - MP 0.10 - Begin Section

TRAIL NUMBER: T301

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0150 - MP 0.22 - Sign

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T302

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0169 - MP 0.00 - Sign

TRAIL NUMBER: T302

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0169 - MP 0.00 - Trailhead

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T302

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0170 - MP 0.10 - Sign

TRAIL NUMBER: T304

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0177 - MP 0.00 - Trailhead

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T304

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0178 - MP 0.00 - Sign

TRAIL NUMBER: T304

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0182 - MP 0.12 - Begin Section

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T304

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0181 - MP 0.16 - Sign

TRAIL NUMBER: T304

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0183 - MP 0.24 - Sign

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T304

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0187 - MP 0.24 - Begin Section

TRAIL NUMBER: T305

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0209 - MP 0.00 - Trailhead

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T305

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0210 - MP 0.05 - Sign

TRAIL NUMBER: T305

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0213 - MP 0.07 - Sign

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T305

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0216 - MP 0.06 - Begin Section

TRAIL NUMBER: T306

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0220 - MP 0.00 - Trailhead

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T306

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0219 - MP 0.01 - Sign

TRAIL NUMBER: T306

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0217 - MP 0.23 - Sign

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T400

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0139 - MP 0.00 - Trailhead

TRAIL NUMBER: T400

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0140 - MP 0.02 - Begin Section

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T402

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0189 - MP 0.00 - Sign

TRAIL NUMBER: T402

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0192 - MP 0.00 - Trailhead

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T402

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0191 - MP 0.01 - Sign

TRAIL NUMBER: T402

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0193 - MP 0.23 - Sign

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T402

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0196 - MP 0.37 - Sign

TRAIL NUMBER: T402

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0198 - MP 0.41 - Begin Section

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T402

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0203 - MP 0.52 - Sign

TRAIL NUMBER: T402

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0204 - MP 0.60 - Sign

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T402

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0201 - MP 0.46 - Sign

TRAIL NUMBER: T402

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0206 - MP 0.46 - Begin Section

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T500

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0165 - MP 0.00 - Trailhead

TRAIL NUMBER: T500

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0166 - MP 0.02 - Begin Section

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T500

STATION: Aransas

DATE: 03/15/2011



Photo # ARAN_C2_0167 - MP 0.04 - Boardwalk -lf

TRAIL NUMBER: T502

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0221 - MP 0.00 - Trailhead

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T502

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0222 - MP 0.02 - Sign

TRAIL NUMBER: T503

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0224 - MP 0.00 - Sign

PHOTOGRAPHIC SHEET

TRAIL NUMBER: T503

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0225 - MP 0.00 - Trailhead

TRAIL NUMBER: T503

STATION: Aransas

DATE: 03/16/2011



Photo # ARAN_C2_0227 - MP 0.03 - Sign

Glossary of Terms and Abbreviations

Acc Info	Accessibility information available at trailhead.
Action	Action required to correct deficiency.
Admin Road	Administration Road. Admin Roads signed and advertised as trails are included in the trail inventory but a condition assessment is NOT done.
Alt SAMMS	SAMMS number of Alternate Facility Type.
Alt Type	Alternate Facility Type. Trail lies on a feature such as a levee, dam, administrative road or bridge, which has a separate SAMMS number.
AvgGrade	The average grade of the trail (%). The average of five measurements for trails less than two miles and ten measurements for trails equal to or greater than 2 miles.
AvgSlope	The average cross-slope of the trail (%). The average of five measurements for trails less than two miles and ten measurements for trails equal to or greater than 2 miles.
Check Dam	A small dam constructed across a drainage ditch, swale, or channel to lower the speed of concentrated flows.
Condition	Subjective rating of trail based on Facility Condition Index (FCI): FCI \leq .01 = Excellent FCI .02 - .05 = Good FCI .06 - .10 = Fair FCI .11 - .20 = Poor FCI $>$.20 = Failed
Crib Wall	Retaining wall.
Current Replacement Value (CRV)	The value of an asset determined by the estimated cost of replacing it.
Def type	Deficiency Type: Trail Structure, Drainage, Erosion, Obstacle, Trail Location, Other.
Deferred Maintenance (DM)	Maintenance that was not performed when scheduled.

Elem ID	Unique identifier for each trail section: Org Code-Trail Number-Section Number.
Facility Condition Index (FCI)	DM/CRV
Grouped Features	Grouped features include non-unique signs (mileposts, interpretive signs, species identification, etc.), water bars, check dams, steps, drain and drainage dips. For any given grouped feature, a GPS point and photo are taken for the first occurrence only and the total number of features in the group are entered into the “quantity” field of the data dictionary.
Info Type	Type of accessibility information available at trailhead: brochure, sign or other.
Item	Item on which the “Action” (see above) will be performed.
Manage_Use	Managed use of the trail: HIKE, BIKE, NSPC (non-specified), PACK, POR (portage), SNOWSHOE, XSKI (cross-country ski), OTHER.
MP	Distance of a trail feature or deficiency from the Trailhead.
Puncheon	Log footbridge used in area of poor drainage.
Raised Trail Structure	Boardwalk, Turnpike, Puncheon.
T Class	Trail Class: I-V (see Appendix ? for trail class descriptions).
Tr Desig	Trail Designation: Standard (Std), National Historic Trail (NHT), National Recreation Trail (NRT), National Scenic Trail (NST).
Turnpike	Trail tread elevated with dirt, rock or other aggregate from parallel side ditches and held in place by logs.